

# ES\_LPC122x

Errata sheet LPC1224/25/26/27

Rev. 1.3 — 13 September 2013

Errata sheet

## Document information

Info	Content
<b>Keywords</b>	LPC1227FBD64, LPC1227FBD48, LPC1226FBD64, LPC1226FBD48, LPC1225FBD64, LPC1225FBD48, LPC1224FBD64, LPC1224FBD48 errata
<b>Abstract</b>	<p>This errata sheet describes both the known functional problems and any deviations from the electrical specifications known at the release date of this document.</p> <p>Each deviation is assigned a number and its history is tracked in a table.</p>



**Revision history**

Rev	Date	Description
1.3	20130913	<ul style="list-style-type: none"><li>Added I2C.1.</li></ul>
1.2	20120321	<ul style="list-style-type: none"><li>Corrected initial device revision from '-' to 'A'.</li></ul>
1.1	20120119	<ul style="list-style-type: none"><li>Added ADC.2.</li></ul>
1	20110501	<ul style="list-style-type: none"><li>Initial version.</li></ul>

**Contact information**

For more information, please visit: <http://www.nxp.com>

For sales office addresses, please send an email to: [salesaddresses@nxp.com](mailto:salesaddresses@nxp.com)

## 1. Product identification

The LPC122x devices typically have the following top-side marking:

```
LPC122x
/xxx
xxxxxxx
xxYYWWxR[x]
```

The last letter in the last line (field 'R') will identify the device revision. This Errata Sheet covers the following revisions of the LPC122x:

**Table 1. Device revision table**

Revision identifier (R)	Revision description
'A'	Initial device revision

Field 'YY' states the year the device was manufactured. Field 'WW' states the week the device was manufactured during that year.

## 2. Errata overview

**Table 2. Functional problems table**

Functional problems	Short description	Revision identifier	Detailed description
ADC.1	PIO0_2, PIO1_5 trigger sources do not operate properly	'A'	<a href="#">Section 3.1</a>
ADC.2	A/D Global Data register should not be used with burst mode or hardware triggering.	'A'	<a href="#">Section 3.2</a>
I2C.1	In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register.	'A'	<a href="#">Section 3.3</a>
RTC.1	Self-timed wakeup from Deep-Sleep requires WDOsc	'A'	<a href="#">Section 3.4</a>

**Table 3. AC/DC deviations table**

AC/DC deviations	Short description	Product version(s)	Detailed description
n/a	n/a	n/a	n/a

**Table 4. Errata notes table**

Errata notes	Short description	Revision identifier	Detailed description
n/a	n/a	n/a	n/a

### 3. Functional problems detail

---

#### 3.1 ADC.1: PIO0\_2, PIO1\_5 trigger sources to ADC do not operate properly

**Introduction:**

There are two asynchronous trigger inputs to the analog to digital converter: PIO0\_2 and PIO1\_5. There are also four timer driven synchronous trigger sources controlled by timer MAT events.

**Problem:**

Asynchronous trigger events on PIO0\_2 and PIO1\_5 can be lost by the analog to digital converter. Synchronous sources are unaffected and can be used without issue.

**Work-around:**

None.

#### 3.2 ADC.2: A/D Global Data register should not be used with burst mode or hardware triggering

**Introduction:**

On the LPC122x, the START field and the BURST bit in the A/D control register specify whether A/D conversions are initiated via software command, in response to some hardware trigger, or continuously in burst ("hardware-scan") mode. Results of the ADC conversions can be read in one of two ways. One is to use the A/D Global Data Register to read all data from the ADC. Another is to use the individual A/D Channel Data Registers.

**Problem:**

If the burst mode is enabled (BURST bit set to '1') or if hardware triggering is specified, the A/D conversion results read from the A/D Global Data register could be incorrect. If conversions are only launched directly by software command (BURST bit = '0' and START = '001'), the results read from the A/D Global Data register will be correct provided the previous result is read prior to launching a new conversion.

**Work-around:**

When using either burst mode or hardware triggering, the individual A/D Channel Data registers should be used instead of the A/D Global Data register to read the A/D conversion results.

### 3.3 I2C.1: In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register

#### Introduction:

The I2C monitor allows the device to monitor the I2C traffic on the I<sup>2</sup>C-bus in a non-intrusive way.

#### Problem:

In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register. If this is not done, the received data from the slave device will be corrupted. To allow the monitor mode to have sufficient time to process the data on the I<sup>2</sup>C-bus, the device may need to have the ability to stretch the I2C clock. Under this condition, the I2C monitor mode is not 100 % non-intrusive.

#### Work-around:

When setting the device in monitor mode, enable the ENA\_SCL bit in the MMCTRL register to allow clock stretching.

Software code example to enable the ENA\_SCL bit:

```
LPC_I2C_MMCTRL |= (1<<1); //Enable ENA_SCL bit
```

In the I2C ISR routine, for the status code related to the slave-transmitter mode, write the value of 0xFF into the DAT register to prevent data corruption. In order to avoid stretching the SCL clock, the data byte can be saved in a buffer and processed in the Main loop. This ensures the SI flag is cleared as fast as possible.

Software code example for the slave-transmitter mode:

```
case 0xA8:      // Own SLA + R has been received, ACK returned
case 0xB0:
case 0xB8:      // data byte in DAT transmitted, ACK received
case 0xC0:      // (last) data byte transmitted, NACK received
case 0xC8:      // last data byte in DAT transmitted, ACK received
    DataByte = LPC_I2C->DATA_BUFFER; //Save data. Data can be process in Main loop
    LPC_I2C->DAT = 0xFF;              // Pretend to shift out 0xFF
    LPC_I2C->CONCLR = 0x08;          // clear flag SI
break;
```

### 3.4 RTC.1: RTC Wake up from Deep-sleep requires use of WDOsc

#### Introduction:

The LPC122x features the ability to wake up from Deep-sleep mode in a self timed manner using the lower power Real Time Clock (RTC). Once RTC is powered and the clock source is configured, a match event will generate an interrupt and wake the LPC122x.

#### Problem:

In order to wake from Deep-sleep via RTC, the system must be clocked by the WDOsc while in Deep-Sleep.

#### Work-around:

Prior to entering Deep-sleep the WDOsc must be powered, and the main clock source selection register must source the main clock with the WDOsc. The WDOsc must be configured to use the lowest operating frequency by selecting the 0.5 MHz input (FREQSEL) and post divide value of 64 (DIVSEL). The Deep-sleep mode configuration register must be written with values corresponding to the "WD oscillator on" column in Table 44 of the User Manual. Refer to the section "Deep-sleep mode" in the Power Management section of the System Control chapter of the User Manual for additional details and restrictions on Deep-sleep.

## 4. AC/DC deviations detail

---

4.1 n/a

## 5. Errata notes detail

---

5.1 n/a

## 6. Legal information

### 6.1 Definitions

**Draft** — The document is a draft version only. The content is still under internal review and subject to formal approval, which may result in modifications or additions. NXP Semiconductors does not give any representations or warranties as to the accuracy or completeness of information included herein and shall have no liability for the consequences of use of such information.

### 6.2 Disclaimers

**Limited warranty and liability** — Information in this document is believed to be accurate and reliable. However, NXP Semiconductors does not give any representations or warranties, expressed or implied, as to the accuracy or completeness of such information and shall have no liability for the consequences of use of such information. NXP Semiconductors takes no responsibility for the content in this document if provided by an information source outside of NXP Semiconductors.

In no event shall NXP Semiconductors be liable for any indirect, incidental, punitive, special or consequential damages (including - without limitation - lost profits, lost savings, business interruption, costs related to the removal or replacement of any products or rework charges) whether or not such damages are based on tort (including negligence), warranty, breach of contract or any other legal theory.

Notwithstanding any damages that customer might incur for any reason whatsoever, NXP Semiconductors' aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the *Terms and conditions of commercial sale* of NXP Semiconductors.

**Right to make changes** — NXP Semiconductors reserves the right to make changes to information published in this document, including without limitation specifications and product descriptions, at any time and without notice. This document supersedes and replaces all information supplied prior to the publication hereof.

**Suitability for use** — NXP Semiconductors products are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or

malfunction of an NXP Semiconductors product can reasonably be expected to result in personal injury, death or severe property or environmental damage. NXP Semiconductors and its suppliers accept no liability for inclusion and/or use of NXP Semiconductors products in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk.

**Applications** — Applications that are described herein for any of these products are for illustrative purposes only. NXP Semiconductors makes no representation or warranty that such applications will be suitable for the specified use without further testing or modification.

Customers are responsible for the design and operation of their applications and products using NXP Semiconductors products, and NXP Semiconductors accepts no liability for any assistance with applications or customer product design. It is customer's sole responsibility to determine whether the NXP Semiconductors product is suitable and fit for the customer's applications and products planned, as well as for the planned application and use of customer's third party customer(s). Customers should provide appropriate design and operating safeguards to minimize the risks associated with their applications and products.

NXP Semiconductors does not accept any liability related to any default, damage, costs or problem which is based on any weakness or default in the customer's applications or products, or the application or use by customer's third party customer(s). Customer is responsible for doing all necessary testing for the customer's applications and products using NXP Semiconductors products in order to avoid a default of the applications and the products or of the application or use by customer's third party customer(s). NXP does not accept any liability in this respect.

**Export control** — This document as well as the item(s) described herein may be subject to export control regulations. Export might require a prior authorization from competent authorities.

### 6.3 Trademarks

Notice: All referenced brands, product names, service names and trademarks are the property of their respective owners.

## 7. Contents

<b>1</b>	<b>Product identification</b> .....	<b>3</b>
<b>2</b>	<b>Errata overview</b> .....	<b>3</b>
<b>3</b>	<b>Functional problems detail</b> .....	<b>4</b>
3.1	ADC.1: PIO0_2, PIO1_5 trigger sources to ADC do not operate properly .....	4
	Introduction: .....	4
	Problem: .....	4
	Work-around: .....	4
3.2	ADC.2: A/D Global Data register should not be used with burst mode or hardware triggering ..	4
	Introduction: .....	4
	Problem: .....	4
	Work-around: .....	4
3.3	I2C.1: In the slave-transmitter mode, the device set in the monitor mode must write a dummy value of 0xFF into the DAT register .....	5
	Introduction: .....	5
	Problem: .....	5
	Work-around: .....	5
3.4	RTC.1: RTC Wake up from Deep-sleep requires use of WDOsc .....	6
	Introduction: .....	6
	Problem: .....	6
	Work-around: .....	6
<b>4</b>	<b>AC/DC deviations detail</b> .....	<b>6</b>
4.1	n/a .....	6
<b>5</b>	<b>Errata notes detail</b> .....	<b>6</b>
5.1	n/a .....	6
<b>6</b>	<b>Legal information</b> .....	<b>7</b>
6.1	Definitions .....	7
6.2	Disclaimers .....	7
6.3	Trademarks .....	7
<b>7</b>	<b>Contents</b> .....	<b>8</b>

Please be aware that important notices concerning this document and the product(s) described herein, have been included in section 'Legal information'.

© NXP B.V. 2013.

All rights reserved.

For more information, please visit: <http://www.nxp.com>

For sales office addresses, please send an email to: [salesaddresses@nxp.com](mailto:salesaddresses@nxp.com)

Date of release: 13 September 2013

Document identifier: ES\_LPC122X